

Ship To: SAME AS BELOW

Invoice To: CITY OF BLOOMFIELD

111 W Franklin

Bloomfield IA 52537

MacQueen

4607 SE Rio Court

Ankeny, IA 50021

515-289-9994 • 800-933-1190

Branch							
03 - ANKENY IA							
Date	Time				Page		
07/17/2024	11:	01:05	(0)		1		
Account No	Phone No		Est No 01				
BLOOM002	6416642260		003264				
Ship Via		Purchase Order					
	NEED						
Tax ID No							
			Sale	Salesperson			
				444			

ESTIMATE EXPIRY DATE: 08/16/2024

SERVICE ESTIMATE - NOT AN INVOICE

MS #: 5623581

Stock #: C047282 REEL

Make: EN Model: RAX 300

Is to have the following work done

PM SERVICE QUOTE

COMPLAINT:

CUSTOMER REQUEST PM SERVICE QUOTE WITH UPDATES.

CAUSE:

7/17/24. 95456. LOOKED OVER REEL FOUND CHAIN NEEDS TO BE TIGHTEND UP. FOUND ONE ROLLER SEIZED. FOUND WHITE ROLLER WHERE CABLE RIDES ON STARTING TO MAKE A GROOVE. FOUND ELECTRICAL TAPE WRAPPED AROUND REEL CABLE BLACK HOSE RIGHT BEHIND CONNECTOR. REMOVED ELECTRICAL TAPE FOUND HEAT SHRINK AROUND BLACK HOSE. REMOVED HEAT SHRINK AND FOUND A SPLIT IN THE HOSE. SUGGESTED DOING A RETERM KIT TO REPLACE BAD HOSE. REPLACING IT WOUD INSSURE NO WATER IS GETTING IN AND POSSIBLY GETTING IN TO THE CONNECTOR. ALSO SUGGESTED UNSPOOLING CABLE ALL THE WAY OUT TO CHECK FOR ANY BAD SPOTS IN CABLE AND CLEAN THE WHOLE CABLE. SOFTWARE IS AT 8.31.0. NEEDS TO BE UPDATED TO MOST CURRENT WHICH IS 8.50.0

Part#	Description	<u>Qty</u>	Price	Amount
E-440-0110-00-SP	KIT, TERM	1	941.13	941.13
E-562-0233-00-SP	kit-sp m rolls	1	599.00	599.00
			Parts:	1540.13
			Labor:	1822.50
Authorization:			TOTAL:	3362.63